

Figure 2. Deflector locations with respect to tailwater depth above the basin end sill.

EXPERIENCES

Many stilling basins have experienced abrasion damage, as exemplified below at several Reclamation Dams. Often abrasion has progressed to depths exposing reinforcement and requiring repair of concrete by sawcutting, sandblasting, and concrete replacement with polymer concrete, or silica fume concrete.

Vallecito Dam - Vallecito Dam, completed in 1941, experienced abrasion/erosion damage in the outlet works stilling basin in the 1980's. The repairs involved a silica fume concrete with high slump and 9000 lbs/in² strengths. The work was completed in 1991. The spillway chute has since experienced more erosion indicating this is a continuing problem.

Ridgway Dam - An underwater inspection of the Ridgway Dam outlet works stilling basin revealed that the concrete floor was severely eroded, with the reinforcing bars exposed. The region will have this work repaired using a two phase process. The first phase is to construct bypass capacity to dewater the stilling basin, remove all materials, and determine the extent of repairs needed. The second phase the following year will be to make the repairs. The work scope is not determined but when all is complete the cost may be between \$200,000 and \$1,000,000.

Taylor Draw Dam - In 1991, about \$200,000 was spent to repair abrasion damage to the Taylor Draw Dam outlet works stilling basin. After just one operating season, an inspection revealed that abrasion damage had again occurred. After repairs were complete the second time, a study conducted by WRRL demonstrated that the installation of flow deflectors improved the basin's flow distribution significantly, greatly reducing the potential for movement of material into the basin. The deflectors have been in place for 4 years with no further repairs to the basin concrete required.

THE MODEL

A physical model is being used to investigate hydraulic conditions in Type II stilling basins and to study the affect of deflector positioning and inclination on flow patterns over the basin end sill. The study will be used to optimize and generalize flow deflector designs based on basin geometry and operating conditions. The Ridgway Dam outlet works and its Type II twin bay stilling basin are being used for the model investigations. The model includes the 42-in high pressure slide gates discharging into 2:1 sloping chutes and 12 ft wide bays. The basin is 85 ft long. Froude scaling was used to model the outlet works at a 1:10.5 scale. The downstream riprap apron topography was modeled on a 6:1 slope with moveable bed material to simulate the abrasion source. Unit discharges (q) (corresponding to 40-, 60-, 80-, and 100-percent gate openings for the Ridgway Dam outlet works), and percent of tailwater depth were used to describe flow conditions. Velocity measurements were determined using a sontek acoustic flow meter and were measured at the downstream end of the basin end sill in the center of the bay. Bottom velocities were measured 5.25-in above the basin end sill. All velocities are described in terms of average velocities. Tailwater was set according to the tailwater curve generated for the Ridgway Dam outlet works operations.

INVESTIGATIONS

Flow conditions over the basin end sill were characterized with profiles representing average velocities (negative values represent velocities in the upstream direction) mapped along the vertical axis in the center of the bay for unit discharges of 29 ft³/s/ft (40% gate), 41 ft³/s/ft (60% gate), 52 ft³/s/ft (80% gate), and 60 ft³/s/ft (100% gate) as shown in figure 3×The vertical axis shows the relative depth in percent of total tailwater depth over the basin end sill. Initial investigations determined that the most effective position along the length of the basin was to locate the deflector directly above the downstream slope of the basin dentates. Once this was established, the most effective position along the vertical axis was investigated. Figure 3 shows that as values of unit q increase, the thickness of the high velocity (downstream) jet increases, thereby lowering the transition point between upstream and downstream velocities above the basin end sill. The effectiveness of the flow deflector is dependent on the vertical location of the deflector with respect to this transition point and its ability to trap and redirect a large enough portion of the high velocity jet (immediately above the transition point) to improve flow conditions. With this in mind, three vertical locations and several deflector angles were investigated.

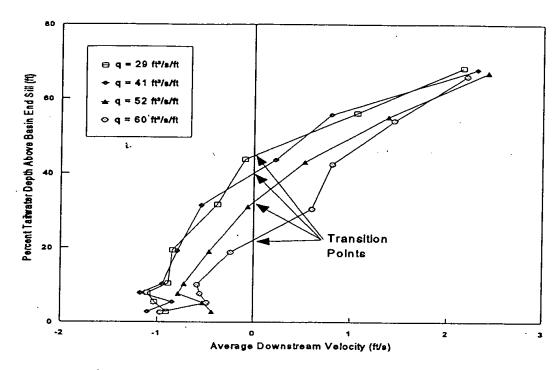


Figure 3. Velocity profiles measured along the vertical axis above the basin end sill.

Babble height

All of the deflectors tested were 4.375 ft deep and were located as shown in figure 2. Deflectors D17 through D19 were positioned at an angle of 60 degrees, and deflectors D20 and D21 were positioned at 70 and 80 degrees, respectively.

Figure 4 shows bottom velocities measured near the basin end sill for deflector positions D17 through D21 for each flow tested. The results of these investigations show that the performance of each deflector varies over the range of flows. When the deflector was positioned low in the basin and just above the transition points of the higher flows (i.e. D17) the deflector performed well at the high flows. However, it became ineffective as the flow was decreased because the transition point moved above the location of the deflector. As a result, at the lower flows, the deflector missed a major portion of the high velocity jet because it was positioned below it. A similar problem occurred when the deflector was positioned too high (i.e. D19). Although the deflector was in good position (just above the transition point) to redirect the jet at the lower flows; as the flow was increased, the transition point moved too far below the deflector for it to remain effective The solution was to position the deflector (D18) between the locations of deflectors D17 and D19 where it would be less sensitive to the movement of the transition point. This produced positive downstream velocities (average) throughout the range of flows.

Next the angle of the deflector was varied. Deflectors D20 and D21 were installed at the same location as D18 except with the angle increased to 70 and 80 degrees respectively.